





ASSEMBLY INSTRUCTION

Push-Bull BNC | 75Ω Cable Connector - Chuck type strain relief

Select the proper connector part number in Neutrik's cable cross reference list!

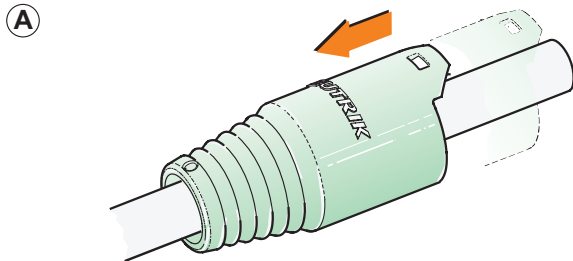


(A) Slide the boot onto the cable.

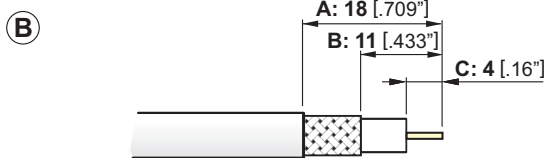

(B) Prepare cable as shown.

- Use an adjustable coaxial cable stripper is recommended.

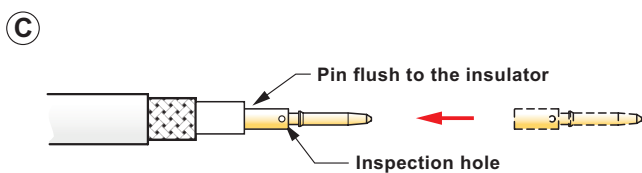


(C) Crimp the pin.

- position the pin on the center conductor
- Crimp the pin with the tool

(For best crimping-results it is recommended to use the original Neutrik crimp tool - HXBNC with the corresponding insert or hexcrimp acc. to IEC 803-W (SW 1.7) or squarecrimp acc. to IEC 803-2 (SW 1.6)

- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

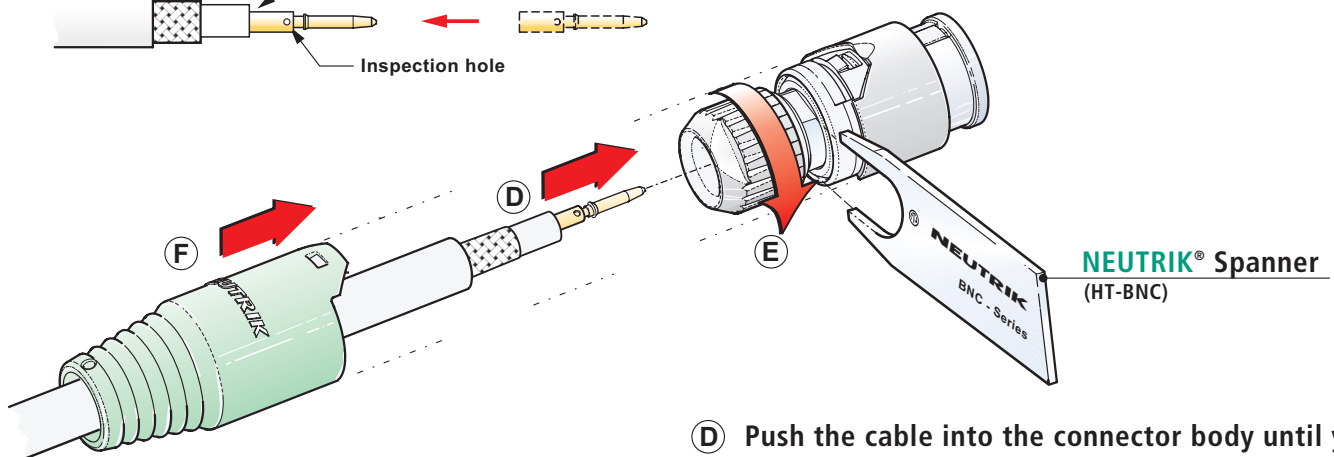


(D) Push the cable into the connector body until you hear a snap.

(E) Tighten the bushing.

- for stronger tightening use the Neutrik Spanner HT-BNC

(F) Snap the sleeve onto the connector body.

Assembled Connector

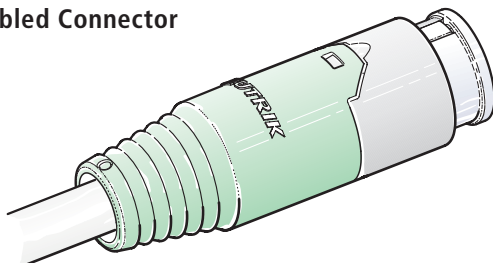

NEUTRIK AG LI T: +423 / 237 24 24 F: +423 / 232 53 93
NEUTRIK Zürich AG CH T: +41 44 / 736 5010 F: +41 44 / 736 5011
NEUTRIK USA Inc. USA T: +1 732 / 901 9488 F: +1 732 / 901 9608
NEUTRIK (UK) Ltd. UK T: +44 1983 / 811 441 F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH DE/NL/AT T: +49 8131 / 280 890 F: +49 8131 / 280 830
NEUTRIK France FR T: +33 1 / 4131 6750 F: +33 1 / 4131 0511
NEUTRIK Tokyo Ltd. JP T: +81 3 / 3663 4733 F: +81 3 / 3663 4796
NEUTRIK Hong Kong Ltd. HK T: +852 / 2687 6055 F: +852 / 2687 6052

Draft. Nr.: BDA 046 / 3102M0761 | Update: 09.04.2008 | Data subject to change without prior notice. ©2008NEUTRIK®. ALL RIGHTS RESERVED.

www.neutrik.com

NEUTRIK